

Stop Use and Action Notification SN 050824

May 2024

Immediate Action Required

Products

3M[™] Scott[™] E-Z Flo and E-Z Flo+ Mask-Mounted Regulators (MMR)

Manufacturing Dates: March 2022 – January 2023




3M Personal Safety Division is issuing a "Stop Use and Inspect" for the 3M[™] Scott[™] E-Z Flo and E-Z Flo+ Mask-Mounted Regulators (MMR) manufactured between March 2022 and January 2023. 3M[™] Scott[™] E-Z Flo and E-Z Flo+ MMR are safe to use once the instructions in this notice are carried out.

Subsequent to the issuance of User Safety Notice SN122022 in December 2022, and User Safety Notice SN030623 in March 2023, 3M Scott Fire & Safety was made aware of an additional of E-Z Flo+ MMR having shipped from our factory with missing mounting latch screws. This unit was manufactured outside the dates indicated in the original Notices. The expanded date range we have identified for inspection includes all E-Z Flo and E-Z Flo+ regulators manufactured between March 2022 through January 2023 inclusive. Although we are confident from our inspections that this date range covers all potential instances of missing screws, we encourage inspection of all units in your fleet as per our User Instructions and Operation and Maintenance manuals prior to each use.

Instructions for Users

Upon receipt of this notice, please perform the inspection whose instructions are detailed on Page 1, Figure 2 of the original Notice SN122022 and as shown in Figure 1 below.

Figure 1: Cover Screen Location/Screws Missing versus Cover Screws Installed

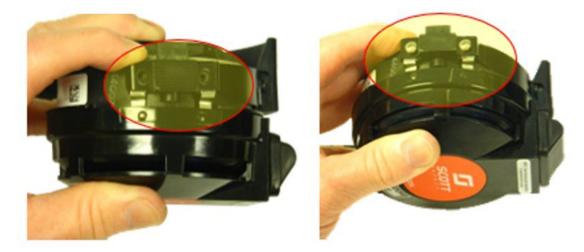

If you identify one or more units within the date range of this notice, **please visually inspect them to ensure the presence** of the mounting screws as shown. If after inspection, it is discovered that an MMR is missing the mounting latch screws, take the MMR out of service and contact your 3M Scott Fire & Safety Authorized Service Center to complete the repairs required. Please note that it is unlikely a fielded SCBA, having been placed in service and previously inspected, would have missing screws.

Instructions for Distributors

Upon receipt of this Notice, immediately forward this Notice to any of your customers who have purchased affected products from you and provide any assistance requested by your customers to complete the inspection process.

We apologize for any inconvenience caused. If you have any additional questions about this Notice please contact your 3M Scott Authorized Service Center, or 3M Scott Technical Support so that a service professional can assist you in completion of the Notice. 3M Scott Technical Support can be contacted at 1-800-247-7257, or scotttechsupport@3m.com, or through the web at www.3M.com/ScottFire.



Personal Safety Division 4320 Goldmine Road Monroe, NC 28110

In United States of America or Canada Technical Service 1-800-247-7257 Customer Service 1-800-247-7257 3M.com/ScottFire © 3M 2024. All rights reserved. 3M and Scott are trademarks of 3M Company and its affiliates, used under license in Canada.

3M PSD products are occupational use only.